

IE– Calibration

Use remote controller to operate.

Items Operating Steps Display Notes Press ▲ for 2 seconds. P - - - -

Input password '8416' via [-0- / ↑] and [T/→]. P8416

Entering the Calibration mode

Press [HOLD].

Display shows CLbrt

Press [HOLD] Display shows Un LB

Press [HOLD] Display shows capacity FS _._

Press [HOLD] Display shows LoAd 0

Press [HOLD] Display shows - - - - - then LoAd 1

Hang on the load, and press [HOLD].

Input the load's weight via [-0- / ↑] and [T/→].

Press [HOLD] to save the weight value and detect load weight. - - - - - will display weight then END

Wait for several seconds after the scale complete the load detection. Bring down weight. Calibration ends