

*SPIDER*TM

Terminal
Technical Manual

METTLER TOLEDO is recognized around the world for manufacturing and marketing high quality scales and weighing systems. With roots tracing back to 1901, the company takes pride in its long established record of employing innovation, technology, and a close working relationship with its customers to meet the diverse needs of the global marketplace. METTLER TOLEDO's worldwide headquarters are in Greifensee, Switzerland. Corporate offices for the North American Marketing Organization are in Columbus, Ohio.

©Mettler-Toledo, Inc., 2000, 1998

No part of this manual may be reproduced or transmitted in any form or by any means, electronic or mechanical, including photocopying and recording, for any purpose without the express written permission of Mettler-Toledo, Inc.

U.S. Government Restricted Rights: This documentation is furnished with Restricted Rights.

CUSTOMER FEEDBACK

Your feedback is important to us! If you have a problem with this product or its documentation, or a suggestion on how we can serve you better, please fill out and send this form to us. Or, send your feedback via email to: quality_feedback.mtwt@mt.com. If you are in the United States, you can mail this postpaid form to the address on the reverse side or fax it to (614) 438-4355. If you are outside the United States, please apply the appropriate amount of postage before mailing.

Your Name:		Date:
Organization Name:		METTLER TOLEDO Order Number:
Address:		Part / Product Name:
		Part / Model Number:
		Serial Number:
		Company Name for Installation:
Phone Number: ()	Fax Number: ()	Contact Name:
E-mail Address:		Phone Number:

Please check the appropriate box to indicate how well this product met your expectations in its intended use?	
<input type="checkbox"/>	Met and exceeded my needs
<input type="checkbox"/>	Met all needs
<input type="checkbox"/>	Met most needs
<input type="checkbox"/>	Met some needs
<input type="checkbox"/>	Did not meet my needs

 
Comments/Questions:

DO NOT WRITE IN SPACE BELOW; FOR METTLER TOLEDO USE ONLY				
<input type="checkbox"/> Retail	<input type="checkbox"/> Light Industrial	<input type="checkbox"/> Heavy Industrial	<input type="checkbox"/> Custom	
RESPONSE: Include Root Cause Analysis and Corrective Action Taken.				



812745800A


FOLD THIS FLAP FIRST



NO POSTAGE
NECESSARY IF
MAILED IN THE
UNITED STATES

BUSINESS REPLY MAIL

 FIRST CLASS PERMIT NO. 414 COLUMBUS, OH



POSTAGE WILL BE PAID BY ADDRESSEE

Mettler-Toledo, Inc.
Quality Manager - MTWI
P.O. Box 1705
Columbus, OH 43216
USA



INTRODUCTION

This publication is provided solely as a guide for individuals who have received Technical Training in servicing the METTLER TOLEDO product.

Information regarding METTLER TOLEDO Technical Training may be obtained by writing to:

METTLER TOLEDO

1900 Polaris Parkway
Columbus, Ohio USA 43240
Phone (US and Canada): 614-438-4511
Phone (International): 614-438-4888

FCC NOTICE

This equipment has been tested and found to comply with the limits of the United States of America FCC rules for a Class A digital device, pursuant to Part 15 of the FCC Rules and the Radio Interference Regulations of the Canadian Department of Communications. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

ORDERING INFORMATION


It is most important that the correct part number is used when ordering parts. Parts orders are machine processed, using only the part number and quantity as shown on the order. Orders are not edited to determine if the part number and description agree.


**METTLER TOLEDO RESERVES THE RIGHT TO MAKE REFINEMENTS
OR CHANGES WITHOUT NOTICE.**

METTLER TOLEDO® and SPIDER™ are trademarks of Mettler-Toledo, Inc. All other brand or product names are trademarks or registered trademarks of their respective companies.

PRECAUTIONS

- Read this manual before operating or servicing this equipment.
- Always take proper precautions when handling static sensitive devices.
- Do not connect or disconnect load cells or a scale base to the equipment with power connected or damage may result.
- Always remove power and wait at least 30 seconds before disconnecting any cables. Failure to observe this precaution may result in damage to, or destruction of the equipment.
- Save this manual for future reference.
- Call METTLER TOLEDO for parts, information, and service.

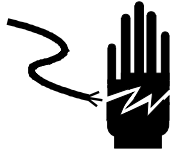	<p>WARNING</p> <p>ONLY PERMIT QUALIFIED PERSONNEL TO SERVICE THIS EQUIPMENT. EXERCISE CARE WHEN MAKING CHECKS, TESTS AND ADJUSTMENTS THAT MUST BE MADE WITH POWER ON. FAILING TO OBSERVE THESE PRECAUTIONS CAN RESULT IN BODILY HARM.</p>
--	--

	<p>CAUTION</p> <p>OBSERVE PRECAUTIONS FOR HANDLING ELECTROSTATIC SENSITIVE DEVICES.</p>
---	--

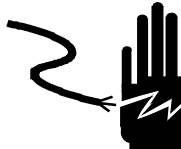
	<p>WARNING</p> <p>REMOVE POWER FROM THE SPIDER TERMINAL AND WAIT A MINIMUM OF 30 SECONDS BEFORE CONNECTING OR DISCONNECTING ANY CABLES FROM PCBs OR LOAD CELLS AS DAMAGE MAY RESULT.</p>
---	---

TABLE OF CONTENTS

1	Introduction	1-1
	Overview	1-1
	Standard Features	1-1
	Optional Features	1-1
	Specifications	1-2
	Physical Dimensions	1-2
	Power Requirements	1-2
	Terminal Specifications.....	1-3
	Standards Compliance	1-4
	AC Power Line Voltage Variation	1-4
	RFI Susceptibility	1-4
	UL Listing	1-4
	CSA Certification	1-4
	Weights and Measures Approval.....	1-4
2	Installation	2-1
	Environment	2-1
	Package Contents	2-1
	Electrical Connections	2-2
	Serial Port Connections	2-2
	Power Supply Connections	2-3
	Power-up Sequence	2-3
	Legal-For-Trade Preparations.....	2-3
3	Service Mode Configuration.....	3-1
	Overview	3-1
	Accessing Service Mode	3-1
	Navigating in Service Mode	3-2
	Unit Program Block	3-2
	Ramp Program Block.....	3-3
	Weighing Cell Program Block	3-3
	Range Program Block	3-4
	Resolution Program Block	3-5
	Calibration Program Block.....	3-5
	Factory Reset Program Block.....	3-6
	List Program Block	3-7
	Restricting Access to Master Mode.....	3-7
	Return Program Block.....	3-7
4	Master Mode Configuration	1
	Overview	1

Accessing Master Mode	1
Navigating in Master Mode.....	2
Function Program Block	2
Auto Zero Correction Program Block.....	3
Auto Tare Program Block.....	4
Automatic Shutdown Program Block.....	4
Power-Up (Save) Program Block	4
Vibration Adapter Program Block	5
Process Adapter Program Block.....	5
Interface 1 Program Block.....	6
1. Reset Interface to Factory	6
2. Communication Parameters Sub-block	7
3. Operating Mode Sub-block.....	7
4. Data Definition Sub-block	8
5. Define Print Format Sub-block	9
6. Define Line Terminator Sub-block.....	10
7. Exit Interface 1 Sub-block	10
Interface 2 Program Block (Optional).....	10
Control Mode Program Block.....	11
List Program Block	11
Restricting Access to Master Mode.....	11
Reset to Factory Program Block.....	12

5 Operating Instructions.....	1
General Information	1
Terminal Display	1
Terminal Keypad	1
Basic Operator Functions	2
Turning the SPIDER Terminal On and Off.....	2
Zeroing the Scale.....	3
Taring the Scale	3
Simple Weighing	4
Transferring Scale Data	5
Weighing Operations With Auto Tare	5
Advanced Operator Functions	6
Unit Switching	6
Displaying Gross Weight	6
Piece Counting.....	7
Formula Weighing	8
Accumulation.....	9
Dynamic Weighing	10

6 Service and Maintenance	6-1
Cleaning and Regular Maintenance.....	6-1
Troubleshooting	6-1
Error Codes and Descriptions	6-2

7	Parts and Accessories	7-1
	SPIDER Terminal	7-1
	Optional Accessories	7-2
Appendices.....		1
	Appendix 1: Geo Codes	1
	Appendix 2: Operating a SPIDER Terminal with PC	3
	Zero the Scale	3
	Tare the Scale	4
	Send Scale Data on Stability.....	4
	Send Scale Data Immediately	4
	Send Scale Data Continuously.....	5
	Send the SPIDER Terminal Serial Number.....	5
	Reset the Interface	6
	MT-SICS Error Messages.....	6

1 Introduction

Overview

The SPIDER terminal is a flexible, general purpose terminal connected to a SPIDER (GB) base that can be used for the following applications:

- Simple weighing
- Weigh-in operations
- Weigh-out operations
- Piece counting
- Formula weighing
- Dynamic weighing
- Accumulation

For added flexibility, the terminal can be mounted to the wall with an optional wall-mount kit. The SPIDER terminal's inherent simplicity makes it easy to perform various weighing and counting operations regardless of your familiarity with METTLER TOLEDO products or scales.

Standard Features

The SPIDER terminal comes with the following standard features:

- Compact and rugged extruded aluminum industrial enclosure
 - Integrated functions for special applications such as formula and/or dynamic weighing
 - Convenient 5-key keypad
 - Large and easy-to-read LCD digital display
 - RS232 bi-directional serial data interface
-

Optional Features

Serial RS-232C (0917-0219)

A second RS-232 serial interface can be installed in the SPIDER terminal. The second interface is designed to operate hardware components using XON/XOFF handshaking. The second serial interface can be used to connect serial peripheral devices such as a printer, personal computer, or auxiliary display.

RS232C Interface Cable (0900-0313)

The Interface cable's 15 feet (4.6 meter) length allows attachment of computers, printers and other peripherals to the scale's serial interfaces.

Battery Kit Attachment (0917-0222)

The battery attachment allows you to operate the SPIDER terminal away from a conventional power supply. The battery kit uses four standard (or four rechargeable) C-size batteries. A symbol in the SPIDER terminal display indicates when battery power is too low for accurate operation.

Wall Mount Kit (0917-0220)

The optional wall mount kit lets you install the SPIDER terminal display terminal on nearly any vertical surface. The stainless steel constructed kit contains all mounting parts including screws and dowels.


Secondary Display (0917-0221)

You can connect a secondary remote display to the SPIDER terminal via any of the serial interfaces. This remote provides display information only (no keyboard control.)

Specifications

Physical Dimensions

The SPIDER terminal measures 9.25 in. (23.5 cm) wide, 5.63 in. (14.3 cm) deep, and 2.5 in. (6.35 cm) high.

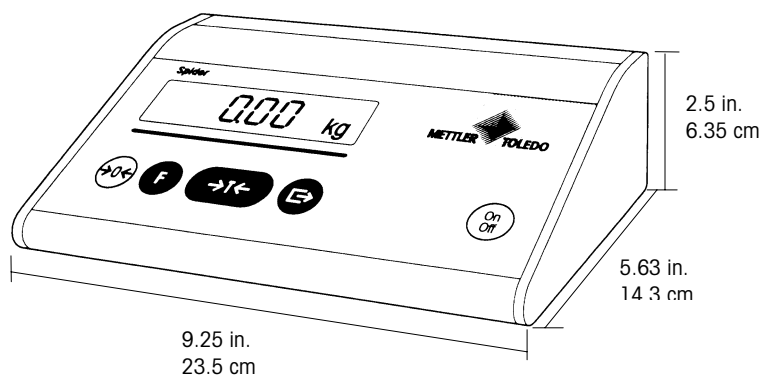

Power Requirements

A 6 VDC (500 mA) AC adapter provides power to the SPIDER terminal. It can also be powered by an optional battery pack that uses rechargeable or conventional batteries. A symbol in the display indicates when battery power is too low for accurate operation. NOTE: A SPIDER terminal with four analog load cells has a maximum operating life of up to 25 hours with alkaline-manganese batteries and up to 11 hours with NiCad rechargeable batteries.

Terminal Specifications

Specifications of the SPIDER Terminal	
Resolution	<p>1K to 5K divisions for non-certified applications (non legal-for-trade) 1K to 3 K divisions for certified applications (legal-for-trade)</p> <p>Selection of resolutions exceeding 5 divisions is not recommended. The SPIDER terminal may permit higher resolution choices, but could result in poor weighing performance such as instability or non-repeatability.</p>
Filters	<p>Vibration adapter (matching the ambient conditions) Process adapter (matching the type of weighing)</p>
Max. Display Range	5 increments over capacity
Zero Setting Range	1.2% of the total load cell capacity
Auto Zero Range	0.16% of the stated scale's weighing capacity
Start-up Zero Range	-1.4% to +12.6% of the total load cell capacity
Max. Preload	70% of the nominal load of the stated scale weighing capacity
Numeric Increments	1, 2, 5 multiples
Decimal Positions	From 0.0002 to 200
Linearity	0.033 percent of the total load cell capacity
Units	g, kg, t, lb
Interface	RS-232C bi-directional
Baud Rate	300 to 9600 baud
Parity	8 bits (no parity), 7 bits (even/odd parity)
Handshake	none, XON/XOFF, hardware
Max. Data Rate	20 weight values per second
Operating Mode	Printout at keystroke, printout on changing load, dialog (SICS)

Standards Compliance

AC Power Line Voltage Variation

The SPIDER terminal meets NIST HB-44, Canadian Gazette Part 1, and OIML-SP7/SP2 line voltage variation specifications as listed in the following table:

AC Power Line Voltages						
Line Voltage Variation Specification	AC Line Voltage			Line Frequency in Hz		
	Minimum	Nominal	Maximum	Minimum	Nominal	Maximum
NIST HB-44	100	120	130	59.5	60	60.5
Canadian	108	120	132	58.8	60	61.2
OIML-SP7/SP2	102	120	132	58.8	60	61.2
	187	220	242	49.0	50	51
	204	240	264	49.0	50	51

RFI Susceptibility

The SPIDER terminal meets USA, Canadian, VDE 0871 Class B, UK requirements for RFI susceptibility as listed in the following table with a maximum of one display increment of change when calibrated for recommended builds.

Radio Interference Frequency	Field Strength
26-1000 MHz	3 volts/meter

UL Listing

The 120 VAC power adapter complies with UL requirements and carries the UL label.

CSA Certification

The 120 VAC power adapter complies with CSA requirements and carries the CSA label.

Weights and Measures Approval

The SPIDER terminal is NTEP Class III 5000d approved (CoC 96-184). The SPIDER terminal is Industry Canada approval for 5000d (AM5168).

2

Installation

Environment

If you have moved a certified unit, please contact METTLER TOLEDO to have the scale recalibrated and certified at its new location.

Before installing the scale, note the following:

- **Vibration**•Vibration diminishes the scale's ability to measure accurately. Electrical machinery such as conveyors and drill presses can cause inaccurate, non-repeatable readings. The scale may also read inaccurately if it is not balanced properly.
- **Air Currents**•Moving air can cause the scale to read an additional force (additional weight) and have the same affect as vibration.
- **Temperature Stability**•Scales at temperatures lower than room temperature can read inaccurately as the scale measures the change in resistance of the strain gauges when weight is applied to the scale. To ensure accurate readings, let the scale warm-up approximately 30 minutes before using it.
- **Electrical Influences**•Fluctuations in the electrical power supply can affect performance and possibly damage the load cell. The scale should be set apart from equipment that generates static electricity. "Clean" power should be used at all times to avoid damage.
- **Friction**•A scale cannot measure accurately if an object is rubbing or pressing against the platter.
- **Moisture/Humidity**•Moisture and humidity can corrode electrical circuitry.
- **Other**
 - Operate the scale at -10°C to $+40^{\circ}\text{C}$ ($+14^{\circ}\text{F}$ to 104°F).
 - Do not locate or operate the scale in a hazardous area.
 - Do not locate or operate the scale in a wet area.
 - Place the scale in a stable location with little or no vibration.
 - Do not place the scale in a location subject to excessive drafts.

Package Contents

The package contents includes:

- SPIDER scale
- Technical manual
- AC adapter (configured to national codes)
- Scale capacity, increment, and units labels

Contact your METTLER TOLEDO representative immediately if any components are missing or damaged.

Electrical Connections

The SPIDER terminal is attached and configured to the GB base. No wiring is required.

Serial Port Connections

The SPIDER terminal is equipped with an RS-232C serial port that is accessible from the rear of the terminal. This serial port is a standard sub-miniature DB-9 female serial connection that can be used for compatible serial devices such as a printer or personal computer. The following diagram shows the pin assignments of the serial port connector:

Pin	Signal	
1	NC	No connection
2	TxD	Send line of SPIDER terminal
3	RxD	Receive line of SPIDER terminal
4	DSR	Receive handshake (I-face 2 only)
5	GND	Signal ground
6	DTR	Send handshake (I-face 2 only)
7	NC	No connection
8	NC	No connection
9	NC	No connection

The following METTLER TOLEDO devices use the RS-232 connection shown below:

SPIDER terminal	Device	METTLER TOLEDO Serial Printers		
2	3	8806	8807	8845
5	7	8846	8856	8857
		8861	8865	

Using interface cable number 09000313, ensures both electrical and mechanical compatibility between the terminal and printers above.

SPIDER terminal	Device TB-2	METTLER TOLEDO Serial Accessories		
2	2	8617	9323	9325
5	3			

Chapter 4, Master Mode Configuration, provides additional information describing how to configure data for printing through the serial port connection. The Appendix section entitled **Operating Instructions Using a PC** describes how to use the SPIDER terminal from a PC connected through the serial port.

Power Supply Connections

Apply power by inserting the molded end of the power cable to the rear of the terminal then plugging the modular power supply into a properly grounded AC power outlet.

Power-up Sequence

If the display shows NO after the power-up sequence, the scale must capture zero before displaying weight.

The SPIDER terminal goes through a series of self tests when it is turned on. These tests confirm normal operation. The power-up sequence is as follows:

1. All segments of the display window are lit. This verifies operation of all segments.
2. The display shows the terminal software version numbers.
3. The terminal advances to normal operating mode.

The total power-up sequence requires approximately 6 seconds.

Legal-For-Trade Preparations



If you are using the SPIDER terminal with an approved scale in a legal-for-trade application, you must configure it as such when installing it.

- Select the "Approv" option in the Weighing Cell program block, Approval sub-block (in Service mode). This restricts the options in other program blocks to those that provide approved operations.

You can physically seal the terminal to prevent tampering or alteration of its calibration.

- Place a paper seal over one of the left end cap screws (A) and one of the two center end cap screws (B).



You can also seal the terminal using the included cross drilled screws and sealing wiring along with a lead seal.

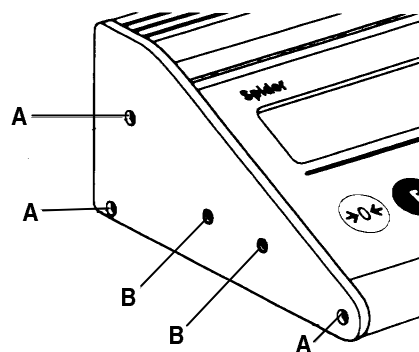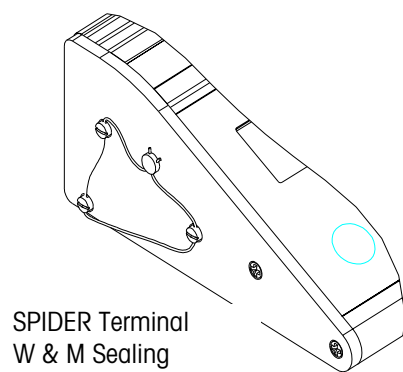

3

Service Mode Configuration


Overview

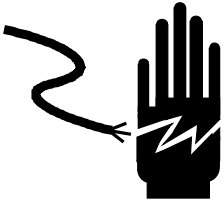	<p style="text-align: center;"> WARNING</p> <p>ONLY PERMIT QUALIFIED PERSONNEL TO PROGRAM METTLER TOLEDO EQUIPMENT. EXERCISE CARE WHEN CREATING PROGRAMS OR MAKING PROGRAM CHANGES WHEN OUTPUTS ARE CONNECTED TO EXTERNAL EQUIPMENT. FAILURE TO OBSERVE THESE PRECAUTIONS CAN RESULT IN BODILY HARM AND/OR PROPERTY DAMAGE.</p>
---	---

The Service Mode lets you configure those parameters governing scale and system setup and calibration. As you configure the program blocks in Service Mode, please keep in mind that the terminal's display is designed for digital numeric characters. Some alphabetical characters cannot be created accurately, and it may take some time to become accustomed to the alpha characters.

Accessing Service Mode

1. Turn the terminal off by pressing the **ON/OFF** button on the keypad.
2. Open the terminal.
3. Slide the circuit board from the enclosure as you did when attaching the terminal to a scale base. (Refer to Chapter 2 of this manual.)
4. Press and hold the red Service Mode access button located to the left of the display as you switch the power to the terminal back on. Hold the red button in until the display verification is complete. The display reads **Service** indicating that you are in Service Mode.

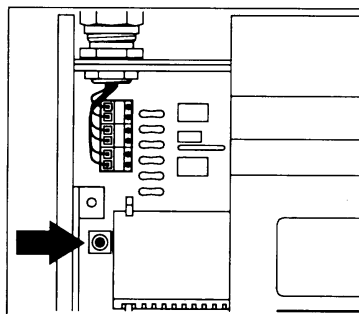

If you cannot reach the button safely with your fingertip, use a non-conductive instrument to press the button. Do not use a metal tool because it may damage sensitive components.

5. Slide the circuit board back into the case and close the unit.

Navigating in Service Mode


You will use only two keys on the SPIDER terminal keypad to configure the program blocks of Service Mode.



ENTER—The ENTER key is used to accept the displayed parameter. **ENTER** corresponds to a “Yes” response. Pressing **ENTER** at the **Service** prompt immediately after accessing Service mode brings up the first program block in Service mode.

TARE—The TARE key is used to refuse the displayed parameter. Pressing **TARE** corresponds to a “No” response. Pressing **TARE** at the **Service** prompt immediately after accessing Service Mode exits this mode.

Unit Program Block

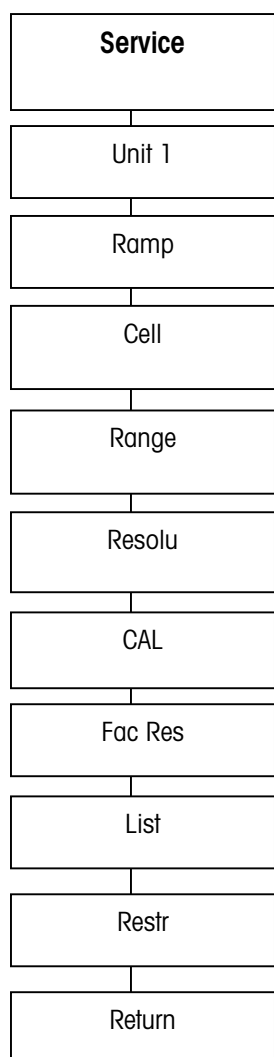

The Unit program block lets you select the basic weighing unit for the SPIDER terminal. To select a weighing unit:

1. At the **Service** prompt, press ENTER to access Service Mode.
2. At the **Unit 1** prompt, press ENTER to access Unit 1. Use the TARE key to
 - Kilogram (kg)
 - Metric ton (t)
 - Gram (g)
 - Pound (lb)
3. Press ENTER to confirm the displayed weighing unit. The SPIDER terminal automatically proceeds to the next Service Mode program block.

Ramp Program Block

The Ramp program block lets you view the current values of the internal analog-to-digital converter. **This is not a calibration critical step.**

1. Press ENTER at the **Ramp** prompt to view the current values or press TARE to bypass. The SPIDER terminal displays the current deflection of the A/D converter in percent.
2. Once you enter the Ramp program block, press TARE to update the value.
3. Press ENTER again to close the Ramp program block and continue to the Serial Number program block.

The following is offered as examples of how the Ramp readings relate to loads on the cell:

Ramp ---> 25% ---> No load on load cell (0 mV)

Ramp ---> 27% ---> Scale with weighing pan in place.

Ramp ---> 77% ---> Scale with 100% of scale capacity loaded.

Ramp ---> 87% ---> Scale with 120% of scale capacity loaded.

Weighing Cell Program Block

The Weighing Cell program block has two sub-blocks that let you select the scale type (certified or non-certified) and set the capacity of the load cell. **These steps are necessary in order to calibrate the scale.**

1. Approval Sub-block

The Approval sub-block lets you select a scale type for the scale currently attached to the SPIDER terminal.

To select the scale type:

1. Press ENTER at the **Cell** prompt to access the sub-block.
2. At the **Approv** prompt, press TARE to display the desired scale type. Options include:
 - Certified scale (**Approv**)
 - Non-certified scale (**No_App**)
3. Press ENTER to confirm the displayed scale type.

2. Capacity Sub-block

The Capacity sub-block lets you configure the **load cell capacity** for the scale currently attached to the SPIDER terminal. To configure the weighing cell capacity:

1. Press ENTER at the **Capacity** prompt to access the sub-block. The display shows the factory default value (**100**). The cursor position is indicated by a horizontal bar at the left of the active digit.
2. Press ENTER to select the digit you want to change. Each time you press ENTER, the cursor moves one position to the right.
3. Press TARE to change the numeric value of the active digit. Each time you press TARE, the digit is incremented by one.
4. Repeat steps 2 and 3 for each digit you wish to configure. When the right-most digit is configured, the SPIDER terminal displays the **Cap OK** prompt.
5. Press ENTER at the **Cap OK** prompt to confirm the weighing cell capacity and continue to the Range program block.

Alternately, you can press TARE at the **Cap OK** prompt to return the cursor to the beginning of the Capacity sub-block.

Range Program Block

(Scale Weighing Capacity)

The Range program block lets you specify the upper limit value of the **SCALE WEIGHING CAPACITY**. If the upper weighing limit is exceeded by weight on the scale, an overload error message is displayed. The section entitled Troubleshooting in Chapter 6 lists error messages for the SPIDER terminal.

To configure the upper limit of the weighing range:

1. Press ENTER at the **Range** prompt. The SPIDER terminal displays the default upper weighing range limit (**60%** of the load cell(s) capacity). The cursor position is indicated by a horizontal bar at the left of the active digit.
2. Press ENTER to select the digit you want to change. Each time you press ENTER, the cursor moves one position to the right.
3. Press TARE to change the numeric value of the active digit. Each time you press TARE, the digit is incremented by one.
4. Repeat steps 2 and 3 for each digit you wish to configure. When the right-most digit is configured, the SPIDER terminal displays the **Rn OK** prompt.
5. Press ENTER at the **Rn OK** prompt to confirm the upper limit of the weighing range and continue to the Resolution program block.

Alternately, you can press TARE at the **Rn OK** prompt to return the cursor to the beginning of the Range sub-block.

Resolution Program Block

The Resolution program block lets you select the desired weight display resolution for the weighing system. Resolution is selectable in display increments. The SPIDER terminal determines all possible display increments. The smallest increment selection available results in **5,000** (3,500 for certified scales) or fewer display increments.

To configure the weighing system resolution:

1. Press ENTER at the **Resolu** prompt. The SPIDER terminal displays the first possible resolution value based on the nominal load of the load cell(s).
2. Press TARE to display the desired resolution value. Each time you press TARE, the next value is displayed.
3. Press ENTER to confirm the displayed resolution value and continue to the Calibration program block.

Calibration Program Block

The Calibration program block lets you calibrate the weighing system.

Cal Program Block

The Cal program block prompts you through the actual calibration of the weighing system. To calibrate the system:

1. Press ENTER at the **Cal** prompt to access the calibration sub-block.
2. The calibration sub-block allow settings of a Geo value for correcting the acceleration due to gravity or calibration of the scale with calibration weights.

Enter the Geo value according to the list in the Appendix. When you press TARE, the terminal displays the values in succession. Press ENTER to confirm the Geo value and advance to the next step (CALEXE).

Press ENTER to begin calibration and proceed to the Set_PI (Set Preload) prompt.

3. At the **Set PL** prompt, place a preload on the weighing platform. For example, the preload may be a container that will be used for each weighing transaction. The preload is not included in the actual weight displayed for the load in the container. The sum of the preload and the selected weighing range must not exceed **70%** of the nominal load of the weighing cell.
4. Press ENTER to begin calibration. The SPIDER terminal displays horizontal segments as it captures zero.

After the preload is set, the SPIDER prompts you through the remaining calibration steps.

5. At the full load prompt (ex. **60.00 kg**), press TARE to select the full-load calibration weight value that you will use to calibrate the system. The full-load prompt varies depending on the capacity of the load cell currently connected to the terminal. You can select a value less than full value if desired.
6. Place the selected full-load calibration weight on the scale, then press ENTER to perform the calibration.
7. At the **Unload** prompt, remove the calibration weight from the scale. Press ENTER when the weight is removed. The SPIDER terminal automatically continues to the **Facres** (Factory Reset) program block.

Factory Reset Program Block

The Factory Reset program block allows selected portions of the Service mode program blocks to be automatically reset to the factory default values.

To initiate a factory reset:

1. Press the ENTER key at the **Facres** prompt to enter the Factory Reset mode.
2. Press ENTER at the **Std. On** prompt.

To bypass Factory Reset:

Press TARE at the **Facres** prompt. The Menu advances to the List program block.

Service mode Default Settings

Units	lb
Serial number	Factory assigned
Approval	Non Approved
Capacity	100% of load cell rating
Range	60% of load cell capacity
Resolution	According to scale range selection

List Program Block

The List program block lets you print a copy of the current Service mode configuration if a compatible serial printing device is connected to the terminal. To print the Service mode configuration: Press ENTER at the **List** prompt. The SPIDER terminal automatically sends the current configuration to the printer and continues to the Return program block. The example below shows a sample printout. In addition to the values configured for the Service mode program blocks, the printout includes the zero capture range and auto-zero range.

```
*****  
— — SPIDER Terminal — —  
Cell:  
  approved    OFF  
  capacity 100.000 [kg]  
  Range      60.000 [kg]  
  Resolution  0.050 [kg]  
*****
```

Restricting Access to Master Mode

You can restrict access to Master mode by:

- Pressing ENTER at the rEStr (Restrict) prompt.
- Pressing TARE to select the display prompt ON or OFF.
- Pressing ENTER to confirm this selection.
- Pressing TARE at the End prompt to continue to the next program block.
- Alternately, press ENTER to quit the Master mode and return to normal operating mode.

Return Program Block

The Return program block lets you exit Service mode. You can select to save any changes you have made to the Service mode program block parameters, or you can return to any Service mode program block and make additional changes.

1. Press ENTER at the **Return** prompt to exit Service mode and save all changes. Alternately, you can press TARE to return to the first program block (Unit) and make additional changes.

When you press ENTER to exit, the SPIDER terminal is in "Control Mode" as indicated by an asterisk in the upper left-hand corner of the display. In control mode the weighing system operates with expanded resolution to check the



Service mode parameter settings. This lets you verify the settings before you close the unit and begin weighing transactions in normal operating mode.

2. Switch the SPIDER terminal off, then on with the ON/OFF key to return to normal operating mode.

4

Master Mode Configuration

Overview

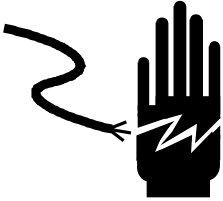	<div data-bbox="1013 495 1321 554"> WARNING</div> <p data-bbox="857 583 1471 760">ONLY PERMIT QUALIFIED PERSONNEL TO PROGRAM METTLER TOLEDO EQUIPMENT. EXERCISE CARE WHEN CREATING PROGRAMS OR MAKING PROGRAM CHANGES WHEN OUTPUTS ARE CONNECTED TO EXTERNAL EQUIPMENT. FAILURE TO OBSERVE THESE PRECAUTIONS CAN RESULT IN BODILY HARM AND/OR PROPERTY DAMAGE.</p>
---	--

In Master Mode, you can set parameters governing scale operation and customize the SPIDER terminal to meet your particular needs. Master Mode includes 12 program blocks in which you can:

- Assign a specific weighing application to a Function key
- Enable/disable auto zero correction
- Enable/disable the auto tare function
- Enable/disable the automatic shutdown feature
- Enable/disable the power-up zero function
- Set the vibration adapter
- Set the process adapter
- Configure both SPIDER terminal interfaces (1 and 2)
- Increase the display accuracy
- Print Master Mode settings
- Restrict access to the Master Mode
- Reset Master Mode settings to factory default values

The SPIDER terminal display is designed for digital numeric characters. Some alphabetical characters cannot be created accurately, and it may take some time to become accustomed to the alpha characters.

Accessing Master Mode

To access Master mode:

1. Press and hold the ENTER key for approximately five seconds until the display reads **[Master]**. Access to Master mode may be restricted by a restricted programming selection made in Master mode.

Navigating in Master Mode

You will use two keys on the SPIDER terminal keypad to configure the program blocks of Master mode.



ENTER—The ENTER key is used to accept the displayed parameter. ENTER corresponds to a “Yes” response. Pressing ENTER at the Master prompt immediately after accessing Master mode brings up the first program block in Master mode.



TARE—The TARE key is used to refuse the displayed parameter. Pressing TARE corresponds to a “No” response. Pressing TARE at the Master prompt immediately after accessing Master mode exits Master mode and returns you to the normal weighing mode.

Function Program Block

Several scale functions are available through the SPIDER terminal. The Function program block lets you configure the scale function that will be active in normal operating mode when the FUNCTION key is pressed. Details on using each function in normal operating mode are given in Chapter 5 of this manual.

To configure the Function program block:

1. Press ENTER at the **Master** prompt to access the Function program block.
2. At the **F-Key** prompt, press ENTER to access the function key options, then press TARE to display the desired operating function. Options include:
 - **Gross** (Gross)—Displays the gross weight of the scale load when the FUNCTION key is pressed.
 - **Count** (Count)—Switches to piece counting mode.
 - **Formula Weighing** (Formula)—Lets you weigh in several components into a single container on the scale and determines the total weight and number of components in the total load.
 - **Totalization** (Total)—Lets you weigh several independent loads, one after another, and accumulate the total weight and number of weighments.
 - **Dynamic Weighing** (Dynam)—Determines an average weight over a predetermined sampling period. This is useful for loads that will not become stable such as livestock.
 - **Second Units** (Unit 2)—Lets you select an alternate unit of measure

- **Control Mode** (Ctrl)—When the FUNCTION key is pressed, the expanded resolution is displayed with an asterisk for approximately 5 seconds. The display automatically returns to the normal weighing mode.
- **No Function** (No F)—The FUNCTION key has no assignment at this time.

If You Select Dynamic:

At the **Dynam** prompt, press ENTER to access sampling interval options, then press TARE to display the desired preset sampling interval. Sampling interval options include:

- Short—approximately three seconds
- Med—approximately five seconds
- Long—approximately ten seconds

If You Select Unit 2:

At the **Unit 2** prompt, press ENTER to access the second unit options, then press TARE to display the desired second unit. Second unit options include:

- kg
- g
- lb

3. Press ENTER to select the displayed function choice.
4. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

This block is not available for legal-for-trade (certified) applications.

Auto Zero Correction Program Block

The Auto Zero Correction program block lets you enable/disable this feature. If enabled, the SPIDER terminal automatically compensates for fluctuations in temperature or slight contamination on the scale platform when capturing zero.

To configure the Auto Zero Correction program block:

1. Press ENTER at the **A-Zero** prompt to access the program block, then press TARE to display the desired switch option (On or Off).
2. Press ENTER to confirm the selection.
3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Auto Tare Program Block

The Auto Tare program block lets you enable/disable the auto tare feature. If enabled, the Net annunciator blinks until a load is added to the scale and the scale stabilizes. The terminal automatically tares the load on the scale. You do not need to press the TARE key each time a new container is to be tared. To configure the Auto Tare program block:

1. Press ENTER at the **A-Tare** prompt to access the program block, then press TARE to display the desired switch option (On or Off).
2. Press ENTER to confirm the selection.
3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Automatic Shutdown Program Block

The Automatic Shutdown program block lets you configure the SPIDER terminal to switch itself Off automatically if no operation has taken place in the preceding three minutes. This is useful if you are operating with an optional PowerPac battery to prolong the battery life. To configure the program block:

1. Press ENTER at the **Pwr OFF** prompt to access the program block, then press TARE to display the desired switch option (On or Off).
2. Press ENTER to confirm the selection.
3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Power-Up (Save) Program Block

The Power-up (Save) program block lets you enable/disable the Save feature. If the Save feature is enabled, the SPIDER terminal stores the scale mode at power-down and returns to that mode when powered-up next. If the Save feature is disabled, the scale must capture zero at power-up before the terminal can display weight. To configure the program block:

1. Press ENTER at the **Save** prompt to access the program block, then press TARE to display the desired switch option (On or Off).
2. Press ENTER to confirm the selection.

3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.
-

Vibration Adapter Program Block

The Vibration Adapter program block lets you set the vibration filter to match the conditions at the scale. The vibration filter compensates for disturbances in the scale vicinity. To configure the program block:

1. Press ENTER at the **Vibrat** prompt to access the program block, then press TARE to display the desired switch option. Options include:
 - **Low**—Select Low if the scale is in a virtually disturbance-free environment. With the Low filter selected, the scale is sensitive to external disturbances.
 - **Med**—Select Med if the scale is in a normal environment where extreme vibration conditions are not present.
 - **High**—Select High if the scale is in an unstable environment. The scale will be less sensitive to external disturbances.
 2. Press ENTER to confirm the selection.
 3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.
-

Process Adapter Program Block

The Process Adapter program block lets you select the type of operation that will be performed at the scale. This program block best matches the SPIDER terminal's capabilities with the weighing process.

To configure the program block:

1. Press ENTER at the **Process** prompt to access the program block, then press TARE to display the desired process option. Options include:
 - **Dosing**—Select Dosing if the weighing operation involves dispensing liquid or powdery weighing samples.
 - **Univer**—Select the Universal setting to accommodate most weighing applications.
 - **Abs**—Select Absolute Weighing for check-weighing or weighing samples for piece counting operations.
2. Press ENTER to confirm the selection.

- At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Interface 1 Program Block

Be careful when performing an interface reset. You will lose all previous settings for the interface!

This program block lets you configure the parameters of the SPIDER terminal's built-in serial interface. The Interface program block contains several sub-blocks that let you:

- Reset interface parameters to original factory default settings
- Configure communication parameters
- Set the operating mode for the interface
- Define data for transmission
- Define the format for printed data

As you configure the Interface 1 program block parameters, keep in mind that the configuration of the serial device connected to the port must match the configuration you set here.

1. Reset Interface to Factory

The Reset Interface to Factory is the first sub-block that appears under the Interface 1 program block. This sub-block resets the Interface 1 parameters only. This reset does not affect parameters that you have configured in other program blocks in Master mode. To reset Interface 1 parameters:

- Press ENTER at the **IFace 1** prompt, then press ENTER again at the **Reset** prompt to access the program block.
- Press ENTER at the **Std On** prompt to reset the Interface 1 settings. This will not reset the parameters in the other Master mode program blocks.
- At the **End** prompt, press TARE to continue to the next sub-block. Interface 1 default settings are reset as follows:

Master mode Program Block	Factory Default Setting
Data Transmission Protocol	NO
Parity	8 NO P
Data Transmission Rate	2400 baud
Operating Mode	Print
Data Definition	Gross weight (gross), tare weight (tare), net weight (net), no application specific values
Print Format	Multi (new line for every value)

2. Communication Parameters Sub-block

The Communication Parameters sub-block lets you select the data transmission parameters for the Interface 1 serial port.

1. Press ENTER at the **Comuni** prompt, then press ENTER at the **Proto** prompt to access the protocol options.
2. Press TARE to display the desired protocol option. Options include:
 - **NO**—The SPIDER terminal operates without a data flow protocol. This option is suitable for communication with a printer and a PC.
 - **XON/XOFF**—The SPIDER terminal stops data transmission upon receipt of the XOFF character and resumes transmission on receipt of the XON character. This data flow control helps to eliminate buffer overflow problems that can cause printing errors.
3. Press ENTER to confirm the protocol selection.
4. At the **End** prompt, press TARE to continue to the next parameter.
5. At the **Parity** prompt, press ENTER to access the parity and data bits parameter.
6. Press **TARE** to display the desired option. Parity and data bit options include:
 - 7 data bits/No parity (7 NO P)
 - 8 data bits/No parity (8 NO P)
 - 7 data bits/Even parity (EVEN)
 - 7 data bits/Odd parity (ODD)
7. At the **End** prompt, press TARE to continue to the next parameter.
8. At the **Baud** prompt, press ENTER to access the data transmission rate parameter.
9. Press TARE to display the desired baud rate. Options include:

• 300	• 2400
• 600	• 4800
• 1200	• 9600
10. At the **End Com** prompt, press ENTER to proceed or press TARE to return to the **Proto** prompt. If you press ENTER, at the **End** prompt, press TARE to continue to the sub-block.

3. Operating Mode Sub-block

The Operating Mode sub-block lets you select the operating mode of the Interface. This operating mode pertains to data transferred through the serial port only. It is not related to the Process Adapter program block that you configured earlier.

1. Press ENTER at the **Mode** prompt to access the sub-block.
2. At the **Print** prompt, press TARE to display the desired Interface operating mode. Options include:
 - **Print**—The interface will transfer data to the attached printer. Data transmission is in one direction from the scale to the printer.
 - **Cycle**—The interface will send data to the printer each time the deflection on the scale is greater than 30 divisions. Information is sent in one direction from the scale to the printer and is sent only when the load on the scale is stable. This is sometimes called “auto print.”
 - **Dialog**—The interface will send and receive data from a computer. Data transmission is bidirectional. Please refer to the section in the Appendix entitled Operating Instructions Using a PC for a description of this mode. Reference is also made to ME-21250163, Interface description of Mettler Toledo SPIDER terminal Scales for a description of the command set and the SICS response strings.
 - **2 Disp**—This setting is used to connect an optional auxiliary display to the interface.
 - **Cont**—The interface will send data continuously (with each A/D cycle) in the ID terminal format.
 - **DT**—This is a bidirectional communications mode that responds to the number commands, 1,2,3,4,5 and 6 as well as the corresponding alpha command set of PM/SM scales and balances. Response strings are in the PM/SM format, not SICS.
 - **T-Cont**— **Toledo continuous mode.** Transfer rate is 2 times per second. **This mode is not suitable for process control applications.**
 - **RS Key**— The digital input of the first interface (pin 9) is assigned a key (ENTER, TARE, or FUNCTION). For assignment to one of these three keys, short circuit pin 9 to signal ground (pin 5) and at the same time press the desired key on the SPIDER terminal terminal. Once selected, key function is triggered by a contact closure across pins 5 and 9. A hand or foot switch or similar normally open, momentary contact closure can be used to activate the selected function.
3. Press ENTER to confirm the interface mode selection.
4. At the **End** prompt, press **TARE** to continue to the sub-block.

4. Data Definition

Sub-block

The Data Definition sub-block lets you select the types of data that will be transmitted through the serial interface. The data definition applies only if the interface mode is selected as Print or Cycle.

You can include one, several, or all of the data types in the data definition string. They are not mutually exclusive.

1. Press ENTER at the **DefStr** prompt to access the sub-block.
2. At the **Gross** prompt, press ENTER to include gross weight in the data transmission, or press TARE to exclude gross weight from the data transmission.
3. At the **Net** prompt, press ENTER to include net weight in the data transmission, or press TARE to exclude net weight from the data transmission.
4. At the **Tare** prompt, press ENTER to include tare weight in the data transmission, or press TARE to exclude tare weight from the data transmission.
5. At the **Appl** prompt, press ENTER to access the application-specific values, then press ENTER or TARE at each data option to include or exclude the data in the transmission.

Display	Meaning	Application*			
		1	2	3	4
DISPL	Display value	X	X	X	X
PCS	Piece count	X			
APW	Average Piece Weight	X			
REF CT	Reference Count	X			
CMP WT	Component Weight		X	X	
CMP CT	Component Count		X	X	
NETTOT	Net Total		X	X	
TOTAL	Gross Total			X	
DYN WT	Dynamic Weight				X
2 LINF	Insert 2 blank lines	X	X	X	X

The application-specific values pertain only if the interface mode is selected as Print or Cycle.

This program block is displayed only if a second (optional) serial interface is installed.

* Applications

- | | |
|------------------|--------------------|
| 1 Piece Counting | 3 Totalization |
| 2 Formulization | 4 Dynamic Weighing |

6. At the **EndStr** prompt, press ENTER. At the **End** prompt, press TARE to continue to the sub-block.

5. Define Print Format Sub-block

The Define Print Format sub-block lets you select a line format based on the type of printer you have connected. The print format selection applies only if the interface mode is selected as Print or Cycle.

1. Press ENTER at the **Ln For** prompt to access the sub-block.
2. At the Single prompt, press TARE to display the desired line format. Options include:
 - **Single**—This setting is used for printers with a wide print width. All values are printed on one line. A new line is used for each data record that is printed.

- **Multi**—This setting is used for printers with a narrow print width. Each value is printed on a new line. You can select multi with a normal printer if you want each data value printed on a separate line.
3. Press ENTER to confirm the print format selection.
 4. At the **End** prompt, press TARE to continue to the sub-block.

6. Define Line Terminator Sub-block

The Define Line terminator sub-block allows you to choose the combination of ASCII characters used to terminate a line of data. This step applies only when the interface mode is selected as Print or Cycle.

1. Press ENTER at the **LN End** (Line End) prompt to access the sub-block.
2. Press TARE to display the desired line terminator. Options include:
 - CrLF – Both a carriage return and a line feed character will be sent.
 - Cr – Only a carriage return will be sent.
1. Press ENTER to confirm the line termination selection.
2. At the **End** prompt, press TARE to continue to the next sub-block.

7. Exit Interface 1 Sub-block

This sub-block lets you exit the Interface 1 configuration routine, save the interface parameters you have configured, and return to the next program block in Master mode.

1. Press ENTER at the **End Int** prompt.
2. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Interface 2 Program Block (Optional)

The Interface 2 program block lets you configure the parameters of a second serial interface if one is installed in the SPIDER terminal. This program block contains the same parameters as described above for Interface 1 and is configured exactly as Interface 1 is configured. Because Interface 2 is identical to Interface 1, separate instruction are not given here.

The Reset Interface to Factory is the first sub-block that appears under the Interface 2 program block. This sub-block resets the Interface 2 parameters only. This reset does not affect parameters that you have configured in other program blocks in Master mode.

Control Mode Program Block

The Control program block lets you view the current weight on the scale at a resolution ten times higher than normal resolution (i.e. one more decimal place). This feature is used for test purposes and is available only in Master mode.

To use the Accuracy Control feature:

1. Press ENTER at the **Ctrl** prompt to display the weight currently on the scale at ten times its normal resolution. When you press ENTER, the enhanced scale weight appears in the display with an asterisk.
2. Press ENTER or TARE to normal operating mode and normal weight resolution. When you press ENTER or TARE after viewing scale weight at high resolution using the Control program block, the SPIDER terminal returns to normal operating mode. You must re-enter Master mode if you wish to configure additional program blocks.
3. Re-enter Master mode as described above and press TARE several times to display the next program block (List).

List Program Block

The List program block lets you print your Master mode settings. You should keep a copy of the program block settings in a separate file or location where they can be retrieved should the SPIDER terminal need reconfigured.

To print Master mode settings:

1. Press ENTER at the **List** prompt to access the program block.
2. Press ENTER again at the **Print** prompt to print the Master mode settings.
3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.

Restricting Access to Master Mode

You can restrict access to Master mode by:

- Pressing ENTER at the rEStr (Restrict) prompt.
- Pressing TARE to select the display prompt ON or OFF.
- Pressing ENTER to confirm this selection.

- Pressing TARE at the End prompt to continue to the next program block.
- Alternately, press ENTER to quit the Master mode and return to normal operating mode.

Reset to Factory Program Block

The Reset to Factory program block lets you reset all Master mode parameters except Interface 1 and Interface 2 to their original factory settings. Interface 1 and Interface 2 program block parameters can be reset in the respective Interface program block.

To reset Master mode:

1. Press ENTER at the **Reset** prompt to access the program block.
2. Press ENTER again at the **Std On** prompt to reset the Master mode settings. This will not reset the Interface 1 or Interface 2 program blocks. Master mode program block default settings are reset as follows:

Master mode Program Block	Factory Default Setting
Function (F-Key)	Gross
Auto Zero (A-ZErO)	ON
Auto Tare (A-tArE)	OFF
Automatic Shutdown (PIlr OFF)	OFF
Save	OFF
Vibration Adapter (VibrAt)	Med
Process Adapter (ProcES)	Universal
Restricted Access (rEStr)	OFF

Be careful when performing a Master mode reset. You will lose all previous settings for Master mode except the Interface 1 and 2 settings.

3. At the **End** prompt, press TARE to continue to the next program block. Alternately, you can press ENTER twice to quit Master mode and return to normal operating mode.


5

Operating Instructions

This chapter gives basic information about the SPIDER terminal that an operator will need to become familiar with the product and perform its functions. Step-by-step instructions explain each SPIDER terminal function.


General Information

The following general information provides an overview of the SPIDER terminal's display and keypad.

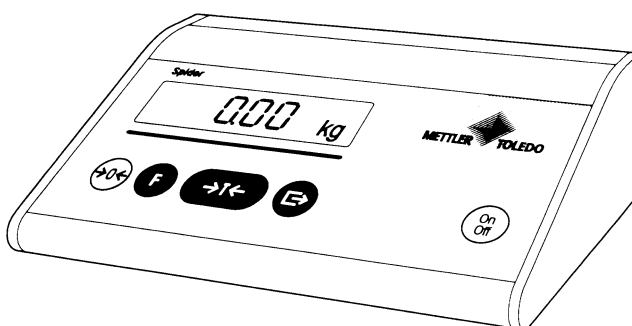

Terminal Display


The SPIDER terminal has a six-character LCD display where scale data and operational messages are displayed. Each character has a decimal point associated with it. The display also contains annunciators as shown below:

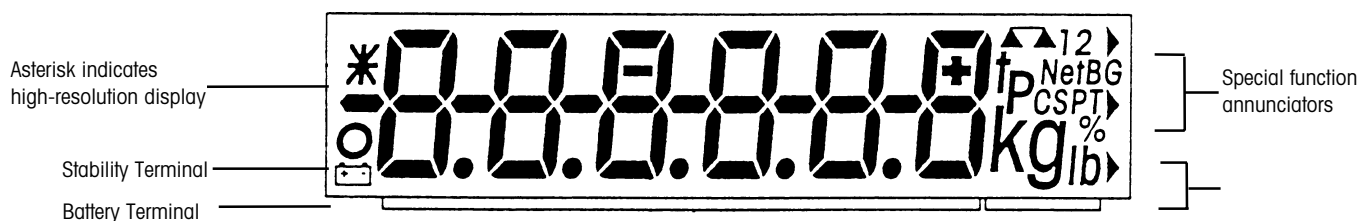

Terminal Keypad

The SPIDER terminal has five keys that perform all of the unit's functions. These keys and their functions are described on the following page.

 The ON/OFF key switches the SPIDER terminal on and off.




In normal operating mode, the **ENTER** key is used to print scale data to a connected, compatible printing device. In Service mode and Master mode, **ENTER** accepts the displayed parameter in a program block. **ENTER** corresponds to a “Yes” response. Pressing **ENTER** at the **Service** or **Master** prompt immediately after accessing Service mode or Master mode brings up the first program block.



In normal operating mode, the **TARE** key is used to tare a container, or compensate for its weight, so the display indicates the net weight of the load on the scale. In Service mode and Master mode, the **TARE** key is used to refuse the displayed parameter. Pressing **TARE** corresponds to a “No” response. Pressing **TARE** at the **Service** or **Master** prompt immediately after accessing Service mode or Master mode exits back to normal operating mode.



The **FUNCTION** key is used to access the SPIDER terminal’s special weighing function capabilities. These are described in detail later in this chapter. Before you can use a special function, you must configure the Function program block in Master mode for that function. Please refer to Chapter 4 for details on configuring the Function program block. The **FUNCTION** key does not have any function in Service mode or Master mode.

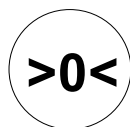

The **ZERO** key is used to return the scale to its zero reference point. Zero can be captured if residual weight on the scale does not exceed $\pm 2\%$ of the scale’s capacity. The **ZERO** key does not have any function in Service or Master mode.

Basic Operator Functions

This section describes how to perform the SPIDER terminal’s most basic operator functions. The SPIDER terminal’s basic functions are independent of the way you have configured the Function program block in Master mode. These functions can be performed as soon as the SPIDER terminal is removed from its box and attached to a compatible scale base.

Please read the following section entitled “Advanced Operator Functions” for information on the SPIDER terminal’s more advanced capabilities.


Turning the SPIDER Terminal On and Off

The ON/OFF key controls power to the SPIDER terminal. You should keep the SPIDER terminal turned off when it is not in use. This will prolong the life of the display and of the battery pack if one is installed. Once your SPIDER terminal is connected and ready for operation, it is recommended that you keep the power cable connected at all times (except for lengthy periods when the scale

is not in use). This will help maintain the terminal's thermal equilibrium and keep it ready for use. To turn the terminal on and off:

1. With the power turned off, press the ON/OFF key once to apply power. The terminal goes through its power-up sequence and performs a brief self-test before advancing to normal operating mode.
2. With the terminal turned on, press the ON/OFF key once to switch the unit off. The terminal briefly displays the message **OFF**, and then the display is blank.

Turning the SPIDER terminal on and off does not affect the power supply to connected peripheral devices and/or the connected scale.

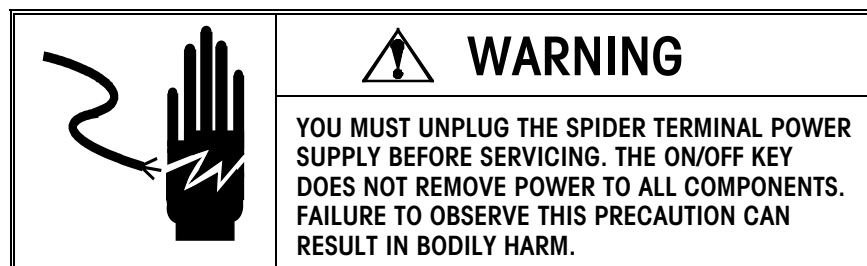

Zeroing the Scale

The ZERO key allows you to reset the SPIDER terminal's point of zero reference at the push of a button. This is useful when residual weight on the scale or environmental conditions prevent the terminal from reading exactly zero.

You can zero the terminal only if weight on the scale does not exceed $\pm 2\%$ of the scale's total capacity.

To zero the scale:

1. Press **ZERO**. The display will show horizontal bars for a short time while the SPIDER terminal automatically captures zero. One of the following situations will follow:
 - If zero was captured successfully, the display reads **0.00** with the current weight unit annunciator lit.
 - If zero was not captured successfully, the SPIDER terminal displays an error message indicating zero is outside the zero capture range.

Taring the Scale

The tare function is often used to compensate for the weight of a container on the scale before adding the load to be weighed. The resulting weight represents the net contents of the container.

To tare the scale:

1. Place the container to be tared on the scale platform. The weight of the container is displayed.
2. Press **TARE**. The SPIDER terminal may display horizontal bar segments until the load on the scale becomes stable. When the load is tared, the display reads **0.00** with the unit and Net annunciators lit.

The SPIDER terminal stores one tare value at a time. If the tared load is removed from the scale, the display shows the tare value with a negative sign (–).

3. Press TARE again (with the scale empty) to clear the tare value before taring the next load.

Simple Weighing

Weighing a Load (No Tare)

1. Press **ZERO** if the display does not read **0.00**.
2. Place the load to be weighed on the scale platform. The SPIDER terminal displays the gross weight of the load with the current weighing unit annunciator lit. If the SPIDER terminal does not sense a stable condition on the scale, the small circle annunciator remains lit until the load becomes stable.
3. Read the gross weight of the load.

Weighing a Load (With Tare)

1. Place an empty container on the scale and press **TARE**. When the load is tared, the display reads **0.00** with the unit and Net annunciators lit.
2. Place the load to be weighed on the scale. The SPIDER terminal displays the net weight of the contents of the container with the unit and Net annunciators lit. If the SPIDER terminal does not sense a stable condition on the scale, the small circle annunciator remains lit until the load becomes stable.
3. Read the net weight of the load.

Weigh-in Operations

Weigh-in operations are similar to weighing a load with tare and are performed as follows:

1. Place an empty container on the scale and press **TARE**. When the load is tared, the display reads **0.00** with the unit and Net annunciators lit.
2. Begin adding sample to be weighed into the container. The SPIDER terminal displays the net weight of the contents of the container with the unit and Net annunciators lit.
3. Continue adding sample until the desired weight is reached.

Weigh-Out Operations

The SPIDER terminal's weigh-out function lets you place a full container on the scale and remove a predetermined amount of weight from the container. SPIDER terminal displays the weight of the quantity removed from rather than added to the scale.

To perform weigh-out operations:

1. Place a full container on the scale.
2. Press **TARE** to tare the load.
3. Begin removing the contents of the container on the scale. The net weight of the removed sample is displayed with a negative sign (–) and the Net annunciator lit.
4. Continue removing contents until you have removed the desired amount.
5. Repeat steps 2 through 4 if you need to remove another quantity from the remaining contents of the container.

Transferring Scale Data

If your SPIDER terminal is connected to a compatible printing device through the RS-232 serial interface, you can transmit the weighing results from the scale to the printer. You can also transmit scale data to a personal computer through the interface. This function is dependent upon the Interface configuration in Master mode.

To transfer scale data:

- With the weighing results displayed on the SPIDER terminal, press **ENTER** to transmit the data through the serial port to the connected device. The terminal transmits the data as soon as a stable condition is detected.

Weighing Operations With Auto Tare

The SPIDER terminal's automatic taring feature automatically tares the first load placed on the scale such as an empty container, and prepares to display the net weight of the next load placed on the scale. This saves the operator the step of manually taring a container before weighing in contents.

The SPIDER terminal's automatic tare feature requires that Auto Tare be enabled in Master mode. When Auto Tare is enabled the Net annunciator blinks in the display to indicate that the scale is waiting for a tare.

To use the auto tare feature:

1. Place a container (empty or full) on the scale to be tared. The SPIDER terminal automatically tares this first weight when the scale becomes stable, then displays **0.00** with the unit and the Net annunciators. While the SPIDER terminal is capturing the tare, the display blanks.
2. Begin adding or removing sample to be weighed. The SPIDER terminal displays the net weight of the contents of the container. A negative sign precedes the net weight if you are removing sample from a full container.
3. Continue adding/removing sample until the desired weight is reached.

Auto Tare remains enabled until you disable the feature in Master mode.

4. Remove the load from the scale. The SPIDER terminal deletes the tare value and the Net annunciator blinks in the display to indicate that the scale is ready for the next tare and weigh transaction.

Advanced Operator Functions

Advanced functions are those functions that rely on the configuration of the Master mode program blocks, particularly the Function program block. These functions are not difficult to perform, but they cannot be done without first configuring the appropriate setup program blocks in Master mode. Please refer to Chapter 4 Master mode Configuration for detailed information on configuring the program blocks that govern advanced operations.

Unit Switching

Unit switching enables you to display scale weight in the unit you have selected as the auxiliary weight unit. The auxiliary weight unit is configured in the Function Key program block in Master mode.

Unit switching requires that *Second Units* be selected as the active function of the FUNCTION key. To switch units:

1. With the scale weight displayed, press **FUNCTION**. The weighing result is automatically converted to the auxiliary unit and displayed with the appropriate weight unit annunciator lit.
2. Press **FUNCTION** to display the result in the first weight unit again.

Displaying Gross Weight

The SPIDER terminal lets you switch back and forth between the net weight and gross weight of a load on the scale that has been placed into a tared container. Gross weight display switching requires that Gross be selected as the active function of the **FUNCTION** key.

To display gross weight:

1. Tare a container and add a load as described above in the section entitled Weighing a Load With Tare. The SPIDER terminal displays the net weight.
2. With net weight displayed, press **FUNCTION**. The SPIDER terminal displays the gross weight of the load (the weight of the container + the weight of the sample in the container).
3. Press **FUNCTION** to display the net weight again.

Each time you press FUNCTION, the display switches between the main and auxiliary weight unit.

Piece Counting

The SPIDER terminal's piece counting feature automatically calculates the total number of pieces weighed into or out of a container using the weight of a representative sample as a reference. The SPIDER terminal uses the sample reference-piece number to calculate the average weight of individual pieces, then divides the total weight by the sample piece weigh for a total piece count.

The SPIDER terminal's piece counting feature requires that *Count* be selected as the active function of the **FUNCTION** key.

You can skip steps 3 through 5 if count-in operations after the first will use the same reference data.

Because the Spider counts pieces based on an average, a larger reference piece count results in greater accuracy.

If the scale was not stable when the reference calculation was attempted or if the reference weight was too low, the Spider returns to normal operating mode.

Count-In Operations

To count a specific number of pieces into a container or to obtain a total piece count of the number of pieces placed into a container:

1. Place an empty container on the scale.
2. Press **TARE** to tare the container.
3. Select a sample reference-piece number as follows:
 - Press and hold the **FUNCTION** key until the current reference-piece number is displayed.
 - Press **TARE** to display the desired reference-piece number. You can choose 1, 2, 5, 10, 20, 50, or 100.
4. Add to the empty container the exact number of pieces that you defined as the reference-piece number.
5. Press **ENTER** to store the weight of the reference quantity. The SPIDER terminal automatically calculates an average piece weight, then displays the total piece count of the reference quantity in the container.
6. Add more pieces to the sample quantity already in the container until the desired quantity is indicated, or until you have obtained a total piece count.
7. Press the **FUNCTION** key to switch between the piece count and the scale weight as desired.
8. Press **ENTER** to print the data according to the Interface program block configuration.
9. To exit the count mode, return to gross zero, zero the scale, and press the **FUNCTION** key to return to the weight mode if in the count mode.

Count-Out Operations

To remove a specific number of pieces from a full container or to count the total number of pieces in a full container:

1. Place a full container on the scale.
2. Press **TARE** to tare the container.

Because the Spider counts pieces based on an average, a larger reference piece count results in greater accuracy.

You can skip steps 3 through 5 if count-out operations after the first will use the same reference data.

If the scale was not stable when the reference calculation was attempted or if the reference weight was too low, the Spider returns to normal operating mode.

3. Select a sample reference-piece number as follows:
 - Press and hold the **FUNCTION** key until the current reference-piece number is displayed.
 - Press TARE to display the desired reference-piece number. You can choose 1, 2, 5, 10, 20, 50, or 100.
4. Remove from the container the exact number of pieces that you defined as the reference-piece number.
5. Press **ENTER** to store the weight of the reference quantity. The SPIDER terminal automatically calculates an average piece weight, then displays the total piece count of the reference quantity removed from the container.
6. Remove more pieces from the container until you have removed the desired quantity, or until you have removed all pieces and obtained a total piece count.
7. Press the **FUNCTION** key to switch between the piece count and the scale weight as desired.
8. Press **ENTER** to print the data according to the Interface program block configuration.
9. To exit the count mode, return to gross zero, zero the scale, and press the **FUNCTION** key to return to the weight mode if in the count mode.

Formula Weighing

Enabling auto tare in Master mode will automate the tare process (step 2).

The SPIDER terminal's formula weighing capability lets you weigh in succession several different components (such as ingredients of a formulation) into a **single** container. The SPIDER terminal keeps track of the total weight on the scale and the number of components you have weighed.

NOTE: The FORMULATION mode accumulates both the GROSS and NET weight. You can recall the NET accumulation, and you can print both the NET and GROSS TOTALS. If the current tare value is zero, the GROSS weight is treated as if it is a net weight. There is no requirement to return to zero before the next transaction is accumulated.

The SPIDER terminal's formula weighing feature requires that *Formula* be selected as the active function of the **FUNCTION** key.

To weigh components of a formula:

1. Place an empty container on the scale.
2. Press **TARE** to tare the container.
3. Add the desired amount of the first component. The SPIDER terminal displays the net weight of the first component.
4. Press **FUNCTION** to store the weight and reset the display to zero. The component weight data will be sent to the printer.
5. Repeat steps 3 and 4 for each component in the formulation.

6. When all components are in the container, press and hold the **FUNCTION** key to display the combined net weight.
7. Press and hold the **FUNCTION** key again to display the total number of components that were weighed into the container.
8. When finished, press the **FUNCTION** key again to return to net zero and add additional components.
9. To clear the stored values of the transaction (total weight, tare value, and number of components), unload the weighing platform and press the **ENTER** key. Alternately you can press the zero key at gross zero to reset the formula weighing.

Accumulation (Totalization)

Enabling auto tare in Master mode will automate the tare process (step 2).

The SPIDER terminal's Accumulation feature lets you weigh in succession several individual loads while the terminal keeps track of the total weight and the number of **individual loads** you have weighed. You can include up to 9999 individual loads in an accumulation. NOTE: The TOTALIZATION mode always uses the NET weight. If the current tare value is zero, the GROSS weight is treated as if it is a net weight. The scale must return to zero (though stability at zero is not required) before the next value is accumulated.

The SPIDER terminal's accumulation feature requires that Total be selected as the active mode of the **FUNCTION** key. To accumulate weight and number of individual weighing transactions:

1. Place an empty container on the scale.
2. Press **TARE** to tare the container.
3. Place the first load of the accumulation on the scale. The SPIDER terminal displays the net weight of the first load.
4. Press **FUNCTION** to store the weight.
5. Unload the weighing platform and return to gross zero.
6. Repeat steps 1 through 5 for each load to be included in the accumulation.
7. When all loads have been weighed, press and hold the **FUNCTION** key to display the total **net** weight of the loads.
8. Press and hold the **FUNCTION** key again to display the total number of individual loads that were weighed.
9. Press and hold the **FUNCTION** key to return to again repeat steps 1 through 5 again for additional loads.
10. To clear the stored values of the transaction (total weight and number of loads), unload the weighing platform and press **ENTER**. Alternately, you can press the zero key at gross zero to reset the formula weighing.

Dynamic Weighing

The SPIDER terminal's dynamic Weighing feature lets you obtain an accurate weight of an unstable load such as when weighing livestock.

The SPIDER terminal's dynamic weighing feature requires that *Dynam* be selected as the active function of the **FUNCTION** key.

To weigh an unstable load:

1. If the unstable load is to be contained, place an empty holding container on the scale and press **TARE**. If the unstable load is to be placed directly on the scale, press **ZERO** to zero the scale.
2. Place the unstable load on the scale.
3. Press **FUNCTION**. After a brief delay, the SPIDER terminal displays an average weight of the load obtained over a sampling period defined in the Function Key program block in Master mode. An asterisk appears in the upper left corner of the display to indicate the result is for a dynamic load.
4. Remove the load.
5. The resulting weight will remain stored on the display until the **FUNCTION** key is pressed again.

6

Service and Maintenance



This chapter gives information on servicing, upgrading, and maintaining the SPIDER terminal including cleaning and regular maintenance, troubleshooting, and installing optional accessories.

Cleaning and Regular Maintenance

You may need to occasionally wipe the keypad and display with a clean, soft cloth that has been dampened with a mild cleaner. Do not use any type of industrial solvent such as toluene or isopropanol (IPA). These may damage the display finish. Do not spray cleaner directly on the terminal.



Troubleshooting

The SPIDER terminal is designed to be virtually error free and reliable. If problems do occur, do not attempt to repair the terminal before you have determined the source of the problem. Record as much information as possible about what has happened including any messages and physical responses. The following troubleshooting information may be helpful to determine the cause of the problem.

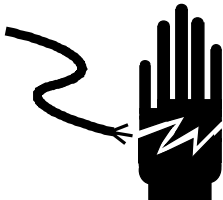	<p> WARNING</p> <p>ONLY PERMIT QUALIFIED PERSONNEL TO SERVICE THIS EQUIPMENT. EXERCISE CARE WHEN MAKING CHECKS, TESTS AND ADJUSTMENTS THAT MUST BE MADE WITH POWER ON. FAILING TO OBSERVE THESE PRECAUTIONS CAN RESULT IN BODILY HARM.</p>
---	---

<p> CAUTION</p> <p>OBSERVE PRECAUTIONS FOR HANDLING ELECTROSTATIC SENSITIVE DEVICES.</p>
--

Error Codes and Descriptions

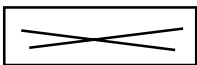
Error Message	Description	Remedy
	Wrong weighing result: Scale not zeroed correctly Weighing pan rubbing Scale not level	Unload scale, zero and repeat weighing Clear tare weight or tare with correct weight Ensure that pan is not touching surroundings Level scale
	Display remains dark: - No line voltage - Scale switched off - Power cable not plugged in - Batteries discharged	Check power supply Switch on scale Plug in power cable Change or charge batteries
ERR 3	Invalid manual entry: - An invalid manual entry was entered in an application	Repeat entry which is valid for the selected application.
ERR 4	Reference weight too small:	Use a larger reference weight
ERR 6	No calibration: - The scale is not calibrated.	Contact your METTLER TOLEDO dealer.
ERR 9	Unstable weight value: - The weight value did not achieve stability	Repeat operation
ERR 50	Attached weighing cell: does not match set data	Check the nominal load setting for the weighing cell in the Capacity sub-block in Service mode. If the sensitivity of the weighing cell is greater than 2 mV/V, ensure that the maximum differential signal is not exceeded.
ERR 51	Maximum capacity exceeded:	Reduce the capacity value in the Cell sub-block in Service mode. The admissible value limit is 100 metric tons.
ERR 52	Upper limit value of the weighing range exceeded:	Reduce the upper limit value of the weighing cell range in the Range sub-block in Service mode. This value cannot exceed 120% of the cell capacity.
ERR 53	Printed circuit board damage:	Contact METTLER TOLEDO. A new PCB may be required.
ERR 59	Admissible range exceeded:	Reduce the preload or the upper limit value of the weighing range in the Range sub-block in Service mode.

7

Parts and Accessories

Please refer to the following diagram and parts list when ordering parts and accessories for the SPIDER terminal.

SPIDER Terminal

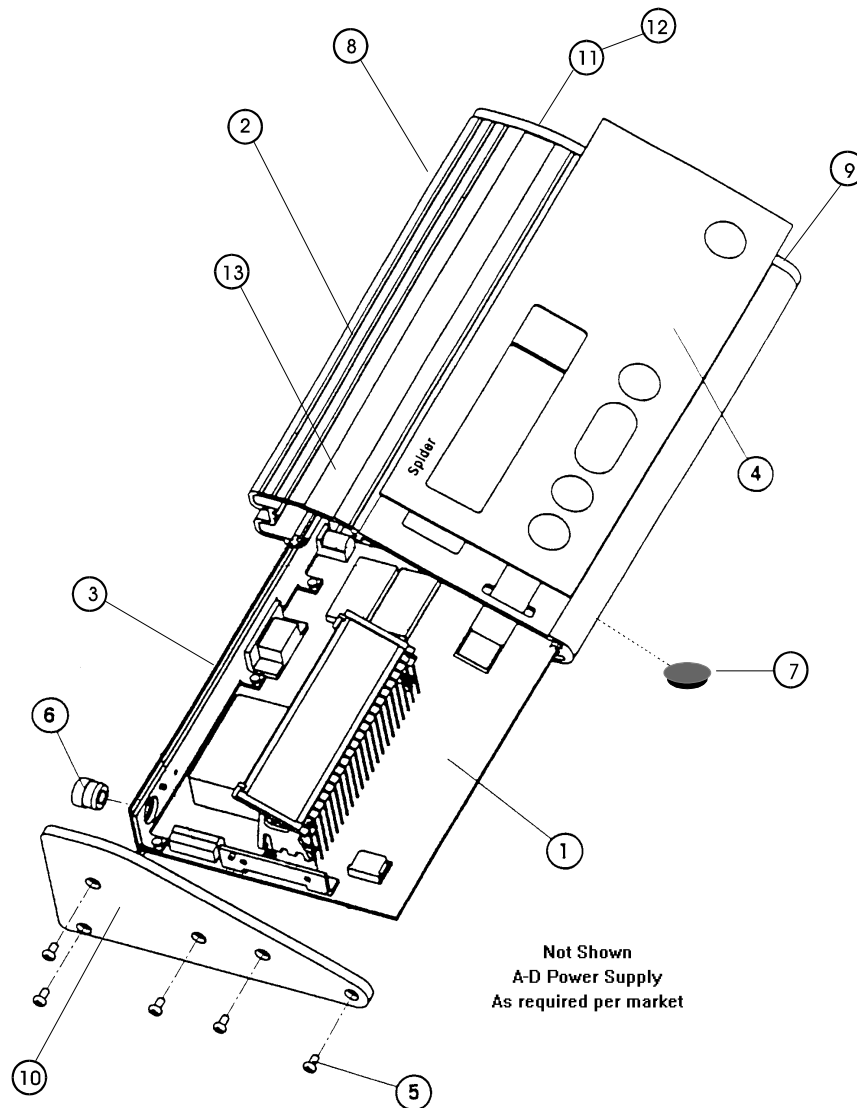

Parts List—SPIDER Terminal			
Ref. #	Part Number	Description	Qty
1	*14876100A	Circuit Board with EPROMS	1
2	* 14592800A	Housing, indicator	1
3	*14593300A	Plate, Rear Panel	1
4	* 145930 00A	Keypad Overlay with Switch	1
5	* R05207 00A	End Cap Fastening Screws	8
6	*13693200A	Load Cell Cable Grip	1
	*13693400A	Nut, Load Cell Cable Grip	1
7	* 10839700A	Foot-Stick on	4
8	*14593500A	Plate, Blank, Rear	1
9	*14593600A	End Cap, Right	1
10	*14593700A	End Cap, Left	1
11	*14115500A	Label, Data	1
12	*14115600A	Shield, Data Label	1
13	*14600500A	Strip, Decorative	1
A	*145958 00A	Power Supply, 120 VAC, 6 VDC, USA	1
B	* 145946 00A	Power Supply, 240 VAC, 6 VDC, UK	1
C	* 145970 00A	Power Supply, 240 VAC, 6 VDC, Aust.	1
D	* 146012 00A	Power Supply, 220 VAC, 6 VDC, Cont. Europe	1

*Number may have an alpha prefix designating revision level.

Optional Accessories

Description	Factory Number	Part Number
Second Serial Interface (RS-232C)	0917-0219-000	14601100A
RS232C Interface Cable	0900-0313-000	14861800A
Secondary Display	0917-0221-000	14903500A
PowerPac Battery Attachment	0917-0222-000	14840000A
Load Cell Adapter Cable—1 foot	0917-0308-000	14863300A
Wall Mount Kit--Painted Mild Steel	0917-0220-000	14594800A
Wall Mount Kit--Stainless Steel	0917-0220-000	14594800A
Column Mounting Kit	0917-0239-000	14900600A
Sealing Kit	0901-0408-000	14892900A

Appendices

Appendix: 1 Geo Codes

Northern and southern latitude in degrees and minutes	Height above sea-level in meters										
	0	325	650	975	1300	1625	1950	2275	2600	2925	3250
	325	650	975	1300	1625	1950	2275	2600	2925	3250	3575
	Height above sea-level in feet										
	0	1060	2130	3200	4260	5330	6400	7460	8530	9600	10660
	1060	2130	3200	4260	5330	6400	7460	8530	9600	10660	11730
0° 0' — 5° 46'	5	4	4	3	3	2	2	1	1	0	0
5° 46' — 9° 52'	5	5	4	4	3	3	2	2	1	1	0
9° 52' — 12° 44'	6	5	5	4	4	3	3	2	2	1	1
12° 44' — 15° 6'	6	6	5	5	4	4	3	3	2	2	1
15° 6' — 17° 10'	7	6	6	5	5	4	4	3	3	2	2
17° 10' — 19° 2'	7	7	6	6	5	5	4	4	3	3	2
19° 2' — 20° 45'	8	7	7	6	6	5	5	4	4	3	3
20° 45' — 22° 22'	8	8	7	7	6	6	5	5	4	4	3
22° 22' — 23° 54'	9	8	8	7	7	6	6	5	5	4	4
23° 54' — 25° 21'	9	9	8	8	7	7	6	6	5	5	4
25° 21' — 26° 45'	10	9	9	8	8	7	7	6	6	5	5
26° 45' — 28° 6'	10	10	9	9	8	8	7	7	6	6	5
28° 6' — 29° 25'	11	10	10	9	9	8	8	7	7	6	6
29° 25' — 30° 41'	11	11	10	10	9	9	8	8	7	7	6
30° 41' — 31° 56'	12	11	11	10	10	9	9	8	8	7	7
31° 56' — 33° 9'	12	12	11	11	10	10	9	9	8	8	7
33° 9' — 34° 21'	13	12	12	11	11	10	10	9	9	8	8
34° 21' — 35° 31'	13	13	12	12	11	11	10	10	9	9	8
35° 31' — 36° 41'	14	13	13	12	12	11	11	10	10	9	9
36° 41' — 37° 50'	14	14	13	13	12	12	11	11	10	10	9
37° 50' — 38° 58'	15	14	14	13	13	12	12	11	11	10	10
38° 58' — 40° 5'	15	15	14	14	13	13	12	12	11	11	10
40° 5' — 41° 12'	16	15	15	14	14	13	13	12	12	11	11
41° 12' — 42° 19'	16	16	15	15	14	14	13	13	12	12	11
42° 19' — 43° 26'	17	16	16	15	15	14	14	13	13	12	12
43° 26' — 44° 32'	17	17	16	16	15	15	14	14	13	13	12
44° 32' — 45° 38'	18	17	17	16	16	15	15	14	14	13	13
45° 38' — 46° 45'	18	18	17	17	16	16	15	15	14	14	13
46° 45' — 47° 51'	19	18	18	17	17	16	16	15	15	14	14
47° 51' — 48° 58'	19	19	18	18	17	17	16	16	15	15	14

METTLER-TOLEDO Spider Service Manual

Northern and southern latitude in degrees and minutes	Height above sea-level in meters										
	0	325	650	975	1300	1625	1950	2275	2600	2925	3250
	325	650	975	1300	1625	1950	2275	2600	2925	3250	3575
	Height above sea-level in feet										
	0	1060	2130	3200	4260	5330	6400	7460	8530	9600	10660
	1060	2130	3200	4260	5330	6400	7460	8530	9600	10660	11730
48° 58' — 50° 6'	20	19	19	18	18	17	17	16	16	15	15
50° 6' — 51° 13'	20	20	19	19	18	18	17	17	16	16	15
51° 13' — 52° 22'	21	20	20	19	19	18	18	17	17	16	16
52° 22' — 53° 31'	21	21	20	20	19	19	18	18	17	17	16
53° 31' — 54° 41'	22	21	21	20	20	19	19	18	18	17	17
54° 41' — 55° 52'	22	22	21	21	20	20	19	19	18	18	17
55° 52' — 57° 4'	23	22	22	21	21	20	20	19	19	18	18
57° 4' — 58° 17'	23	23	22	22	21	21	20	20	19	19	18
58° 17' — 59° 32'	24	23	23	22	22	21	21	20	20	19	19
59° 32' — 60° 49'	24	24	23	23	22	22	21	21	20	20	19
60° 49' — 62° 9'	25	24	24	23	23	22	22	21	21	20	20
62° 9' — 63° 30'	25	25	24	24	23	23	22	22	21	21	20
63° 30' — 64° 55'	26	25	25	24	24	23	23	22	22	21	21
64° 55' — 66° 24'	26	26	25	25	24	24	23	23	22	22	21
66° 24' — 67° 57'	27	26	26	25	25	24	24	23	23	22	22
67° 57' — 69° 35'	27	27	26	26	25	25	24	24	23	23	22
69° 35' — 71° 21'	28	27	27	26	26	25	25	24	24	23	23
71° 21' — 73° 16'	28	28	27	27	26	26	25	25	24	24	23
73° 16' — 75° 24'	29	28	28	27	27	26	26	25	25	24	24
75° 24' — 77° 52'	29	29	28	28	27	27	26	26	25	25	24
77° 52' — 80° 56'	30	29	29	28	28	27	27	26	26	25	25
80° 56' — 85° 45'	30	30	29	29	28	28	27	27	26	26	25
85° 45' — 90° 00'	31	30	30	29	29	28	28	27	27	26	26

Appendix 2: Operating a SPIDER Terminal with PC

The SPIDER terminal interface supports seven commands of the Mettler-Toledo Standard Interface Command Set (MT-SICS). These commands can be tested using a communications program such as Procomm or Windows Terminal on the PC, but the commands are really designed to be integrated into a program. Using these seven commands, you can:

- Zero the scale
- Tare the scale
- Send data record on stability
- Send data record immediately
- Send data records continuously
- Send serial number of scale
- Reset the interface

Before you begin operations with the PC, you should verify the items of the following checklist to ensure accurate communication:

- Be sure the computer is attached correctly to the serial port.
- Set the communication parameters (baud rate, parity, and data bits) of the computer and SPIDER terminal interface to match.
- Configure the operating mode of the interface to Dialog for bi-directional communication.

Zero the Scale

The following steps describe how to zero the scale using the MT-SICS through a PC keyboard:

- On the computer keyboard, press Z, then press CR/LF to send the zero command. As soon as the scale is stable, the weight display of the scale is reset to zero. The character string ZA appears on the computer monitor as confirmation that the command was received.

If the scale cannot be reset to zero, one of the following messages appears on the computer monitor:

- **Z –** means that the zero value on the scale is below the zero setting range.
- **Z +** means that the zero value on the scale exceeds the zero setting range.
- **Z I** means that the command was received and understood; however, it cannot be performed at present.

Tare the Scale

The following steps describe how to tare the scale using the MT-SICS through a PC keyboard:

- On the computer keyboard, press T, then press CR/LF to send the command. As soon as the scale is stable, the current weight on the scale is stored as the tare value, and the scale is reset to zero. The character string TS appears on the computer monitor followed by the tare value and the weighing unit.

If the scale cannot be tared, one of the following messages appears on the computer monitor:

- **T –** means that the weight on the scale to be tared is below the tare range.
- **T +** means that the weight to be tared exceeds the tare range.
- **T I** means that the command was received and understood; however, it cannot be performed at present.

Send Scale Data on Stability

The following steps describe how send scale data when the scale is stable using the MT-SICS through a PC keyboard:

- On the computer keyboard, press S, then press CR/LF to send the command. As soon as the scale is stable, the current net weight value on the scale is sent to the computer. The character string SS appears on the computer monitor followed by the net weight value and the weighing unit.

If the data cannot be sent, one of the following messages appears on the computer monitor:

- **S –** means that the weight on the scale is in the underload range.
- **S +** means that the weight on the scale is in the overload range.
- **S I** means that the command was received and understood; however, it cannot be performed at present.

Send Scale Data Immediately

The following steps describe how to send scale data immediately using the MT-SICS through a PC keyboard:

- On the computer keyboard, press SI, then press CR/LF to send the command. The current scale data is sent to the computer immediately regardless of the stability of the system. The character string SS appears on the computer monitor followed by the net weight value and the weighing unit if the system was stable at the time the command was received. The character string SD appears on the computer monitor followed by the net

weight value and the weighing unit if the system was not stable (i.e. Dynamic) at the time the command was received.

If the data cannot be sent immediately, one of the following messages appears on the computer monitor:

- **S –** means that the weight on the scale is in the underload range.
- **S +** means that the weight on the scale is in the overload range.
- **S I** means that the command was received and understood; however, it cannot be performed at present.

Send Scale Data Continuously

The following steps describe how to send scale data continuously using the MT-SICS through a PC keyboard:

- On the computer keyboard, press SIR, then press CR/LF to send the command. This command sends scale data continuously regardless of the stability of the system.

The character string SS appears on the computer monitor followed by the net weight value and the weighing unit if the system was stable at the time the command was received. The character string SD appears on the monitor followed by the net weight value and the weighing unit if the system was not stable (i.e. Dynamic) at the time the command was received. These results continue to appear on the monitor one after another as long as the system is sending data continuously.

If scale data cannot be sent, one of the following messages appears on the computer monitor:

- **S –** means that the weight on the scale is in the underload range.
- **S +** means that the weight on the scale is in the overload range.
- **S I** means that the command was received and understood; however, it cannot be performed at present.

Send the SPIDER Terminal Serial Number

The following steps describe how to send the SPIDER terminal's serial number to the computer using the MT-SICS through a PC keyboard:

- On the computer keyboard, press I4, then press CR/LF to send the command. The character string I4 A appears on the computer monitor followed by the serial number in quotation marks. The quotation marks indicate a text string rather than scale data.

If the serial number cannot be sent, the following message appears on the computer monitor:

I4 I means that the command was received and understood; however, it cannot be performed at present.

Reset the Interface

The following steps describe how to reset the interface parameters using the MT-SICS through a PC keyboard:

- On the computer keyboard, press @, then press CR/LF to send the command. This command resets the balance to the values that are effective upon power-up, and displays the SPIDER terminal's serial number in quotation marks. The scale is not reset to zero with this command.

The Reset command is carried out immediately, and any other commands that are still awaiting response are canceled. The Reset command can also be used to switch the SPIDER terminal On if it is connected to the computer and is not disconnected from its power supply.

MT-SICS Error Messages

The following error messages may be encountered as you operate the SPIDER terminal using the MT-SICS through a PC keyboard.

- **ET (Transmission Error)**—This error reports that the transmitted data are faulty. Attempt to send the command again. If the error message persists, check the communication parameters and/or the cable connection.
- **ES (Syntax Error)**—This error reports that a command cannot be processed because the command you attempted to enter does not exist (usually a typographic error). Enter the correct command.
- **EL (Logic Error)**—This error reports that a command cannot be carried out because the SPIDER terminal has been switched Off. Switch the SPIDER terminal On and retry the command.

METTLER TOLEDO

1900 Polaris Parkway
Columbus, Ohio 43240

Phone (US and Canada): (614) 438-4511

Phone (International): (614) 438-4888

http: www.mt.com


P/N: C14832900A

12-00

METTLER TOLEDO and SPIDER are registered trademarks of Mettler-Toledo, Inc.

©2000 Mettler-Toledo, Inc.

Printed in U.S.A.

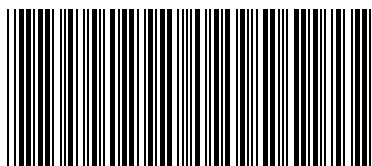

C14832900A